


# 3DPrintMill Profile Support User Manual


3DPrintMill支架使用说明书 V1.0

## 1. List of profile support parts. 支架零件清单。

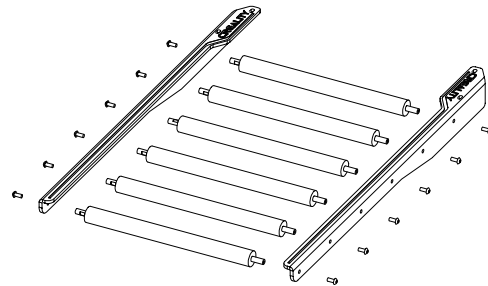


1. 辊筒左支架 X1  
Left bracket of roller X 1
2. 辊筒右支架 X1  
Right bracket of roller X1
3. 辊筒 X6  
Rollers X 6
4. M5\*12 内六角平圆头螺丝 X12  
M5\*12 Socket head flat round head screw X12

## 2. Take out the profile seal on the model and install the bracket as shown in the picture. 将机型上的型材封条取出来，按图所示将支架安装好。

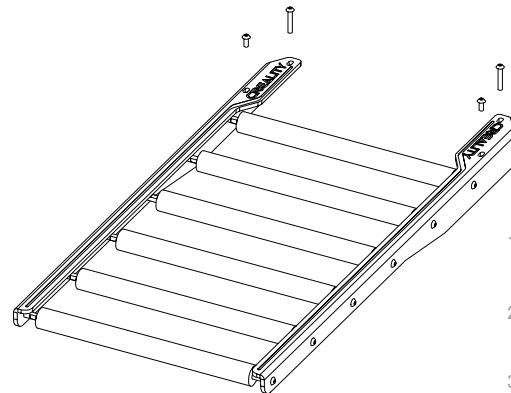


1. M5\*30 Hexagon socket round screw X2  
M5\*30内六角平圆头螺丝 X2
2. M5\*12 Hexagon socket round screw X2  
M5\*12 内六角平圆头螺丝 X2
3. subplate\*2  
垫板

## 3. Install the assembled bracket onto the mounting hole reserved for 3D printer. 将组装好的支架安装到3D打印机预留的安装孔上。

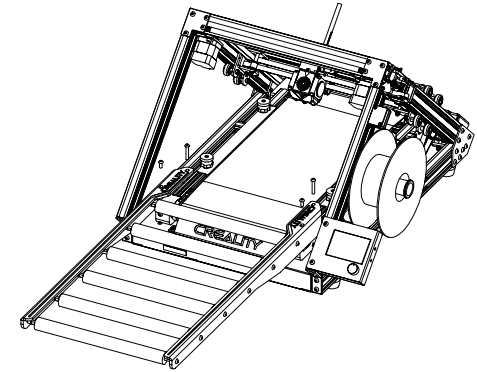

## 4. Renderings after installation. 安装完成后的效果图。

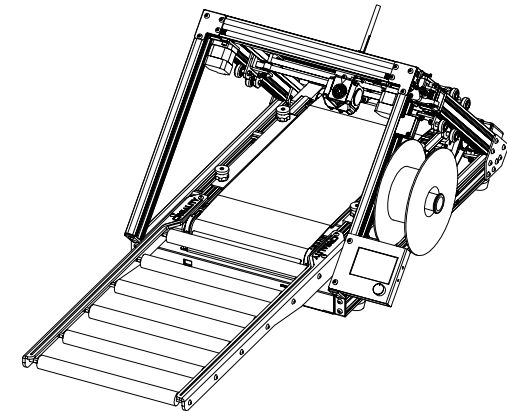

深圳市创想三维科技有限公司

SHENZHEN CREALITY 3D TECHNOLOGY CO., LTD.

Add : 18F, JinXiuHongDu Building, Meilong Blvd.,  
Longhua Dist., Shenzhen, China 518131

Official Website: [www.creality.com](http://www.creality.com) Tel: +86 755-8523 4565

E-mail: [info@creality.com](mailto:info@creality.com) [cs@creality.com](mailto:cs@creality.com)

